

REPORT NUMBER: 301-KAR-18-002
SAFETY COMPLIANCE TESTING FOR FMVSS 301R
FUEL SYSTEM INTEGRITY – REAR IMPACT
79.3 KM/H 70% OVERLAP REAR IMPACT

VOLKSWAGEN DE MEXICO
2018 VOLKSWAGEN TIGUAN 5-DOOR MPV

NHTSA NUMBER: C20185802

PREPARED BY:
KARCO ENGINEERING, LLC.
9270 HOLLY ROAD
ADELANTO, CA 92301



TEST DATE:
JULY 19, 2018

REPORT DATE:
AUGUST 2, 2018
FINAL REPORT

U.S. DEPARTMENT OF TRANSPORTATION
NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION
ENFORCEMENT
OFFICE OF VEHICLE SAFETY COMPLIANCE
ROOM 6111, NVS-220
400 SEVENTH STREET, SW
WASHINGTON, DC 20590

This publication is distributed by the U.S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned, it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Prepared By: Amjad A. Jadallah
Mr. Amjad A. Jadallah, Project Engineer
KARCO Engineering, LLC.

Reviewed By: MD
Mr. Michael L. Dunlap, Director of Operations
KARCO Engineering, LLC.

Approved By: SD
Mr. Steven D. Matsusaka, Engineering Manager
KARCO Engineering, LLC.

Approval Date: August 2, 2018

FINAL REPORT ACCEPTANCE BY OVSC:

Date: _____

TECHNICAL REPORT DOCUMENTATION PAGE

1. Report No. 301-KAR-18-002	2. Government Accession No.	3. Recipient's Catalog No.	
4. Title and Subtitle Final Report of FMVSS 301R Compliance Testing of a 2018 Volkswagen Tiguan 5-Door MPV NHTSA No. C20185802		5. Report Date August 2, 2018	
		6. Performing Organization Code KAR	
7. Authors Mr. Amjad A. Jadallah, Project Engineer, KARCO Mr. Steven Matsusaka, Engineering Manager, KARCO		8. Performing Organization Report No. 301-KAR-18-002	
		10. Work Unit No.	
9. Performing Organization Name and Address KARCO Engineering, LLC. 9270 Holly Rd. Adelanto, CA 92301		11. Contract or Grant No. DTNH22-16-D-00029	
		13. Type of Report and Period Covered Final Test Report, July 19 - August 2, 2018	
12. Sponsoring Agency Name and Address U. S. Department of Transportation National Highway Traffic Safety Administration Enforcement Office of Vehicle Safety Compliance Room 6111, NVS-220 400 Seventh Street, SW Washington, D.C. 20590		14. Sponsoring Agency Code <p style="text-align: center;">NVS-220</p>	
		15. Supplementary Notes	
16. Abstract <p>A 79.3 km/h 70% overlap rear impact test was conducted on the subject 2018 Volkswagen Tiguan 5-door MPV in accordance with the Office of Vehicle Safety Compliance Laboratory Test Procedure No. TP-301R-02 for the determination of FMVSS 301 compliance. The test was conducted at the KARCO Engineering, LLC. facility in Adelanto, California on July 19, 2018.</p> <p>The impact velocity was 79.91 km/h and the outside ambient temperature was 38.9° C. There was no Stoddard solvent leakage immediately after the test or during any portion of the static rollover. The test vehicle appeared to comply with all requirements of FMVSS 301R.</p>			
17. Key Words FMVSS 301R 70% Overlap Rear Impact MDB 2018 Volkswagen Tiguan 5-Door MPV		18. Distribution Statement Copies of this report are available from the following: U.S. Department of Transportation NHTSA Technical Information Services (TIS) Mail Code: NIO-120, Room E-12 -100 1200 New Jersey Avenue, SE Washington, DC 20590 Telephone No. 202-366-4946	
19. Security Classification of this report UNCLASSIFIED	20. Security Classification of this page UNCLASSIFIED	21. No. of Pages 37	22. Price

TABLE OF CONTENTS

<u>Section</u>		<u>Page No.</u>
1	Summary of Test	1
2	Data Sheets	2

<u>Data Sheet No.</u>		<u>Page No.</u>
1	Test Vehicle Specifications	3
2	Pre-Test Data	5
3	Moving Barrier Data	9
4	Post-Test Data	10
5	Static Rollover Test Data	12

<u>Appendix</u>		<u>Page No.</u>
A	Photographs	A

SECTION 1

SUMMARY OF TEST

SUMMARY

The purpose of this rear impact test is to measure the performance of the subject vehicle, a 2018 Volkswagen Tiguan 5-Door MPV, for FMVSS 301 compliance.

This 79.3 km/h 70% Overlap Rear Impact is sponsored by the National Highway Traffic Safety Administration (NHTSA) under contract number DTNH22-16-D-00029. It was conducted in accordance with the Office of Vehicle Safety Compliance Laboratory Test Procedure TP-301R-02 for FMVSS 301R "Fuel System Integrity – Rear Impact", dated January, 2007.

The test was performed at KARCO Engineering, LLC. on July 19, 2018. Pre- and post- test photographs of the vehicle and ATD's can be found in Appendix A of this report.

Three (3) real-time cameras and three (3) high-speed cameras were used to document the rear impact event.

Two Part 572E 50th percentile male anthropomorphic test devices (ATD) were placed in the driver and right front passenger seating positions. Neither of the ATD's were instrumented for this test.

There was no Stoddard solvent leakage after the impact or during any portion of the static rollover. The test vehicle appeared to comply with all requirements of FMVSS 301R-02 "Fuel System Integrity – Rear Impact". FMVSS 301 data is summarized in Data Sheets 4 and 5.

SECTION 2
DATA SHEETS

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

CONVERSION FACTORS

Quantity	Typical Application	Std Units	Metric Unit	Multiply By
Mass	Vehicle Weight	lb	kg	0.4536
Linear Velocity	Impact Velocity	miles/hr	km/hr	1.609344
Length or Distance	Measurements	in	mm	25.4
Volume	Fuel Systems	gal	liter	3.785
Volume	Small Fluids	oz	mL	29.574
Pressure	Tire Pressures	lbf/in ²	kPa	6.895
Temperature	General Use	°F	°C	$=(T_f - 32)/1.8$
Force	Dynamic Forces	lbf	N	4.448
Moment	Torque	lbf-ft	N•m	1.355

DATA SHEET NO. 1
TEST VEHICLE SPECIFICATIONS

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

TEST VEHICLE INFORMATION AND OPTIONS

NHTSA Number	C20185802
Model Year	2018
Make	Volkswagen
Model	Tiguan
Body Style	5-Door MPV
VIN	3VV2B7AX8JM003350
Body Color	Silver
Odometer Reading (km / mi)	113 / 70
Engine Displacement (L)	2.0
Type / No. of Cylinders	Inline 4 Cylinder
Engine Placement	Transverse
Transmission Type	Automatic
Transmission Speeds	8
Overdrive	Yes
Final Drive	AWD
Roof Rack	Yes
Sunroof / T-Top	No
Running Boards	No
Tilt Steering Wheel	Yes
Power Seats	Yes
Anti-Lock Brakes (ABS)	Yes
Automatic Door Locks (ADLs)	Yes

Traction Control System	Yes
Power Steering	Yes
Power Window Auto-Reverse	Yes
Driver Frontal Airbag	Yes
Driver Curtain Airbag	Yes
Driver Head/Torso Airbag	No
Driver Torso Airbag	No
Driver Torso/Pelvis Airbag	Yes
Driver Pelvis Airbag	No
Driver Knee Airbag	No
Front Pass. Frontal Airbag	Yes
Front Pass. Curtain Airbag	Yes
Front Pass. Head/Torso Airbag	No
Front Pass. Torso Airbag	No
Front Pass. Torso/Pelvis Airbag	Yes
Front Pass. Pelvis Airbag	No
Front Pass. Knee Airbag	No
Driver Seat Belt Pretensioner	Yes
Driver Load Limiter	Yes
Front Pass. Seat Belt Pretensioner	Yes
Front Pass. Load Limiter	Yes
Other	No

Does Owner's Manual provide instructions to turn off automatic door locks? Yes

DATA FROM CERTIFICATION LABEL

Manufactured By	Volkswagen De Mexico
Date of Manufacture	May-17

GVWR (kg)	2310
GAWR Front (kg)	1190
GAWR Rear (kg)	1170

VEHICLE SEATING AND CAPACITY WEIGHT INFORMATION


Measured Parameter	Front	Rear	Third	Total	
Type of Seats	Bucket	Bench			
Designated Seating Capacity	2	3		5	
Capacity Weight (VCW) (kg)				440.0	A
DSC x 68 (kg)				340.0	B
Cargo Weight (RCLW) (kg)				100.0	A-B

DATA SHEET NO. 1 ... (CONTINUED)

TEST VEHICLE SPECIFICATIONS

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802

Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

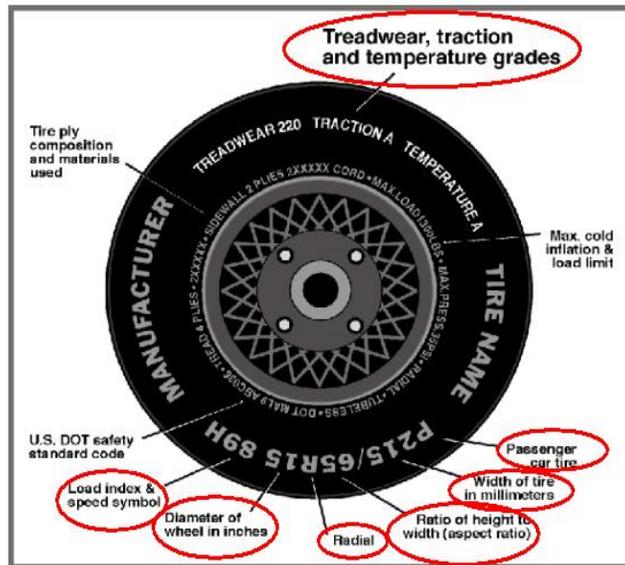

VEHICLE TIRE INFORMATION

Measured Parameter	Front	Rear
Max Tire Pressure (kPa)	350	350
Cold Tire Pressure (kPa)	280	280
Max Load Tire Pressure (kPa)	280	280
Recommended Tire Size	P215/65R17	P215/65R17
Tire Size on Vehicle	P215/65R17	P215/65R17
Tire Manufacturer	Continental	Continental
Tire Model	ProContact TX	ProContact TX
Load Range	775	775
Treadwear Rating	500	500
Traction Rating	A	A
Temperature Grades	A	A
Tire Plies Sidewall	1 Polyester	1 Polyester
Tire Plies Body	1 Polyester, 2 Steel, 1 Polyamide	1 Polyester, 2 Steel, 1 Polyamide
Load Index/Speed Symbol	99H	99H
Tire Material	Polyester, Steel, Polyamide	Polyester, Steel, Polyamide
DOT Safety Code Left	433R WD2B 0317	433R WD2B 0317
DOT Safety Code Right	433R WD2B 0317	433R WD2B 0317
Type of Spare Tire	145/85R18	
Location of Tire Placard on Vehicle	Driver Side B-Pillar	

DATA SHEET NO. 2

PRE-TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802

Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

TEST VEHICLE AXLE WEIGHTS

	Units	As Delivered (UVW)			As Tested (ATW)			Fully Loaded		
		Front	Rear	Total	Front	Rear	Total	Front	Rear	Total
Left	kg	491.5	391.0	882.5	540.0	458.0	998.0	520.5	484.5	1005.0
Right	kg	491.0	372.5	863.5	562.0	427.5	989.5	523.0	467.0	990.0
Ratio	%	56.3%	43.7%	100.0%	55.4%	44.6%	100.0%	52.3%	47.7%	100.0%
Total	kg	982.5	763.5	1746.0	1102.0	885.5	1987.5	1043.5	951.5	1995.0

TARGET TEST WEIGHT CALCULATION

Measured Parameter	Units	Value	
Total Delivered Weight (UVW)	kg	1746.0	A
Actual Weight of 2 P572 ATDs Used	kg	148.0	B
Rated Cargo/Luggage Wt (RCLW)	kg	100.0	C
Calculated Vehicle Target Wt (TVTWT)	kg	1994.0	A+B+C

TEST VEHICLE ATTITUDES

Condition	Units	LF	RF	LR	RR	CG Aft of Front Axle
As Delivered	mm	857	860	873	880	1216
As Tested	mm	842	840	848	855	1239
Fully Loaded	mm	848	851	842	851	1326

GENERAL TEST VEHICLE DATA

Measured Parameter	Units	Value
Total Vehicle Wheel Base	mm	2780
Total Vehicle Length	mm	4685
Total Vehicle Width	mm	1835
Amount of Stoddard Solvent in Fuel Tank	L	56.32

DATA SHEET NO. 2... (CONTINUED)

PRE-TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

BALLAST DATA174

Description	Value
Type of Ballast	Ballast Dummies
Method of Securing Ballast	Seat Belt
Total Weight of Ballast	93.5 kg
Weight of Vehicle Components Removed	0.0 kg

VEHICLE COMPONENTS REMOVED TO MEET TEST WEIGHT:


N/A

FUEL TANK CAPACITY

Description	Liters
Fuel System Capacity Listed in Owners Manual	60.56
Usable Capacity of "Standard Tank"	60.56
91 - 94% of Usable Capacity	55.11-56.93
Actual Amount of Stoddard Solvent Used	56.32

FUEL PUMP

The vehicle is equipped with an electric fuel pump. The fuel pump is activated when the ignition is turned to the "ON" position. The fuel pump will run when the engine is running.

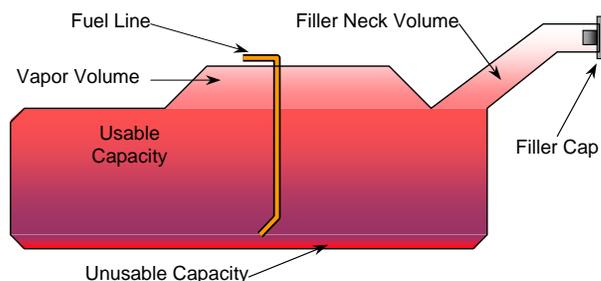

VEHICLE FUEL TANK ASSEMBLY

TEST FLUID

Description	Value
Test Fluid Type	Stoddard Solvent
Test Fluid Specific Gravity	0.758
Test Fluid Kinematic Viscosity	
Test Fluid Color	Purple

DATA SHEET NO. 2... (CONTINUED)

PRE-TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802


Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

NOMINAL DESIGN RIDING POSITION

Seat back angle is measured using a digital inclinometer placed on the headrest post.


SEAT BACK ANGLE

Seating Position	Degrees
Driver Seat Back Angle	18.0
Passenger Seat Back Angle	18.0

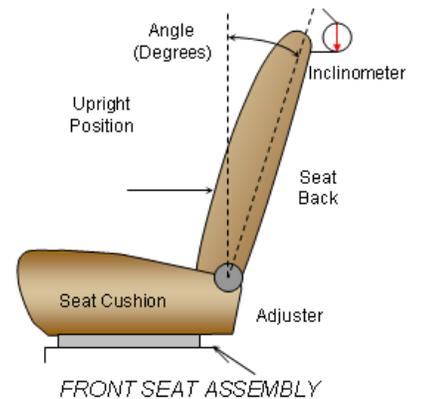

SEAT FORE / AFT POSITIONING

The total seat travel is measured from the forward most possible position to the rear most possible position. The driver's seat is set to the middle of the fore-aft travel. The passenger's seat is set to the middle of the fore-aft travel.

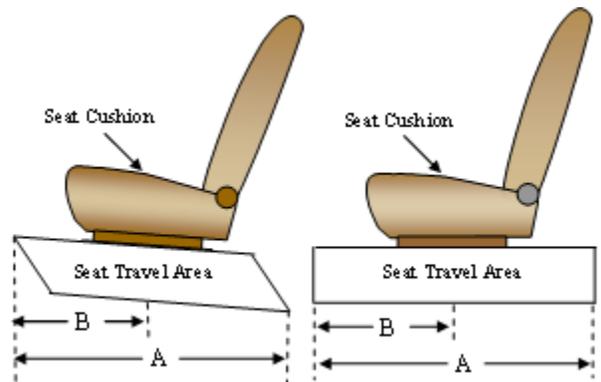

SEAT FORE/AFT POSITIONS

Seating Position	Total Fore-Aft Travel	Placed in Position
Driver Seat	316 mm	158 mm
Passenger Seat	254 mm	103 mm


DATA SHEET NO. 2... (CONTINUED)

PRE-TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802
Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

STEERING COLUMN ADJUSTMENT

Steering wheel and column adjustments are made so that the steering wheel hub is at the geometric center of the locus it describes when moved through its full range of motion. A digital inclinometer is used to measure a plate which is placed across the rim of the steering wheel for angular measurements. A tape measure is used to measure telescoping steering wheel travel.

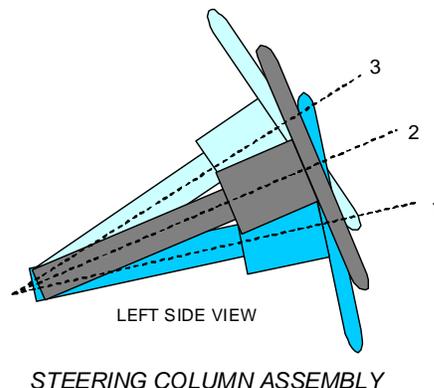

STEERING COLUMN POSITIONING

	Degrees	Fore-Aft Position (mm)
Lowermost Position, No. 1	22.6	72
Geometric Center Position, No. 2	25.3	101
Uppermost Position, No. 3	27.9	130
Telescoping Steering Wheel Travel		58
Test Position	25.3	101

DATA SHEET NO. 3
MOVING BARRIER DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

MOVING BARRIER TEST WEIGHT

	Units	As Tested Weights (ATW)		
		Front Axle	Rear Axle	Total
Left	kg	378.0	296.0	674.0
Right	kg	384.5	304.5	689.0
Ratio	%	55.9%	44.1%	100.0%
Total	kg	762.5	600.5	1363.0

MOVING BARRIER TIRE INFORMATION

Measured Parameter	Front	Rear
Recommended Tire Size	205/75R15	205/75R15
Tire Size on Vehicle	205/75R15	205/75R15
Tire Manufacturer	Pacemark	Pacemark
Tire Model	All Weather	All Weather
Treadwear	420	420
Traction	A	A
Temperature Grades	B	B
Tire Pressure - Front	220	220
Tire Pressure - Rear	220	220

MOVING BARRIER DIMENSIONS

Measurement Description	Length (mm)
Overall Width	1676
Overall Height	559
Honeycomb Depth	381
Overall Depth	483
Bottom Honeycomb to Bottom Bumper	51
Bumper Height	203
Ground to Top of MDB	787
Ground to Bottom of MDB	229
Ground to Bottom of Bumper	280
Ground to Top of Bumper	483

DATA SHEET NO. 4**POST-TEST DATA**Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18Temperature at Time of Impact: 38.9°C Test Time: 12:13 PMVIN: 3VV2B7AX8JM003350**IMPACT VELOCITY DATA**

Measured Parameter	Units	Value
Trap No. 1 Velocity (Primary)	km/h	79.91
Trap No. 2 Velocity (Redundant)	km/h	79.93

IMPACT POINT LOCATION DATA

Measured Parameter	Units	Tolerance	Value
Vehicle Width	mm		1835
Vertical Impact Reference Line (Left of Vehicle Center Line)	mm		367
Actual Impact Point (Left of Vehicle Center Line)	mm		367
Horizontal Offset (+ right / - left)	mm	± 50 of Intended Impact Point	0
Vertical Offset (- down / + up)	mm	± 40 of Intended Impact Point	15

TARGET VEHICLE STRUCTURAL MEASUREMENTS

No.	Description	Pre-Test	Post-Test	Difference
1	Total Length at Centerline	4685	4495	190
2	Total Length	4685	4610	75
3	Total Width	1835	1897	62
4	Left Side Wheelbase	2780	2785	5
5	Right Side Wheelbase	2780	2740	40

MAXIMUM STATIC CRUSH OF HONEYCOMB FACE

Row	Vertical Location		From Centerline		Max. Crush (mm)
	Description	Height (mm)	Distance (mm)	Direction	
A	Center of Bumper	382	800	Left	162
B	Top of Bumper	483	800	Left	190
C	Mid Level	636	400	Left	262
D	Top of Stack	763	800	Left	217

DATA SHEET NO. 4... (CONTINUED)

POST-TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802

Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

DOOR OPENING AND SEAT TRACK INFORMATION

Description	Driver	Passenger
Front Door Opening	Remained closed and latched	Remained closed and latched
Rear Door Opening	Remained closed and latched	Remained closed and latched
Hatch and other doors	Rear Hatch Jammed Shut	

FMVSS 301 FUEL SYSTEM INTEGRITY POST-IMPACT DATA

Stoddard Solvent Spillage Measurements

From impact until vehicle motion ceases: 0 g

(Maximum allowable = 28 g)

For the 5 minute period after motion ceases: 0 g

(Maximum allowable = 142 g)

For the following 25 minutes: 0 g


(Maximum allowable = 28 g/minute)

Spillage: None

DATA SHEET NO. 5
STATIC ROLLOVER TEST DATA

Test Vehicle: 2018 Volkswagen Tiguan 5-Door MPV NHTSA No.: C20185802

Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 07/19/18

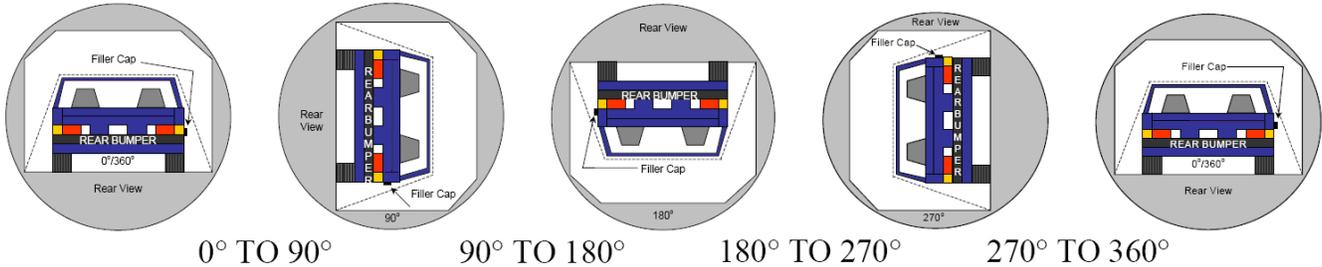

1. The specified fixture rollover rate for each 90° of rotation is 60 to 180 seconds.
2. The position hold time at each position is 300 seconds (minimum).

Details of Stoddard solvent spillage: None

SOLVENT COLLECTION TIME TABLE IN SECONDS

Test Phase	Rotation Time	Hold Time	Total Time
0° To 90°	81	300	381
90° To 180°	80	300	380
180° To 270°	82	300	382
270° To 360°	81	300	381

FMVSS 301 SPILLAGE TABLE

Test Phase	First 5 Minutes	Sixth Minute	Seventh Minute	Eighth Minute
0° To 90°	0 g			
90° To 180°	0 g			
180° To 270°	0 g			
270° To 360°	0 g			

SOLVENT SPILLAGE LOCATION TABLE

Test Phase	Spillage Location
0° To 90°	No Spillage
90° To 180°	No Spillage
180° To 270°	No Spillage
270° To 360°	No Spillage

**APPENDIX A
PHOTOGRAPHS**

TABLE OF PHOTOGRAPHS

Figure		Page
1	As Received Right Front $\frac{3}{4}$ View of Test Vehicle	A-1
2	As Received Left Rear $\frac{3}{4}$ View of Test Vehicle	A-1
3	Test Vehicle Manufacturer's Label	A-2
4	Test Vehicle Tire Information Placard	A-2
5	Pre-Test Front View of Test Vehicle	A-3
6	Post-Test Front View of Test Vehicle	A-3
7	Pre-Test Left Front $\frac{3}{4}$ View Test Vehicle	A-4
8	Post-Test Left Front $\frac{3}{4}$ View Test Vehicle	A-4
9	Pre-Test Left View of Test Vehicle	A-5
10	Post-Test Left View of Test Vehicle	A-5
11	Pre-Test Left Rear $\frac{3}{4}$ View of Test Vehicle	A-6
12	Post-Test Left Rear $\frac{3}{4}$ View of Test Vehicle	A-6
13	Pre-Test Rear View of Test Vehicle	A-7
14	Post-Test Rear View of Test Vehicle	A-7
15	Pre-Test Right Rear $\frac{3}{4}$ View of Test Vehicle	A-8
16	Post-Test Right Rear $\frac{3}{4}$ View of Test Vehicle	A-8
17	Pre-Test Right View of Test Vehicle	A-9
18	Post-Test Right View of Test Vehicle	A-9
19	Pre-Test Right Front $\frac{3}{4}$ View Test Vehicle	A-10
20	Post-Test Right Front $\frac{3}{4}$ View Test Vehicle	A-10
21	Pre-Test Close-Up View of Impact Point Target	A-11
22	Post-Test Close-Up View of Impact Point Target	A-11
23	Pre-Test View of Fuel Filler Cap	A-12
24	Post-Test View of Fuel Filler Cap	A-12
25	Pre-Test Rear Underbody View of Test Vehicle	A-13
26	Post-Test Rear Underbody View of Test Vehicle	A-13
27	Pre-Test Underbody View of Fuel Tank	A-14
28	Post-Test Underbody View of Fuel Tank	A-14
29	Pre-Test Underbody View of Fuel Lines	A-15
30	Post-Test Underbody View of Fuel Lines	A-15
31	Test Vehicle at 0° on FMVSS 301 Static Rollover Device	A-16
32	Test Vehicle at 90° on FMVSS 301 Static Rollover Device	A-16
33	Test Vehicle at 180° on FMVSS 301 Static Rollover Device	A-17
34	Test Vehicle at 270° on FMVSS 301 Static Rollover Device	A-17

TABLE OF PHOTOGRAPHS

<u>Figure</u>		<u>Page</u>
35	Test Vehicle at 360° on FMVSS 301 Static Rollover Device	A-18
36	Impact Event	A-18



FIGURE 1. As Received Right Front ¾ View of Test Vehicle



FIGURE 2. As Received Left Rear ¾ View of Test Vehicle



FIGURE 3. Test Vehicle Manufacturer's Label



FIGURE 4. Test Vehicle Tire Information Placard



FIGURE 5. Pre-Test Front View of Test Vehicle



FIGURE 6. Post-Test Front View of Test Vehicle



FIGURE 7. Pre-Test Left Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 8. Post-Test Left Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 9. Pre-Test Left View of Test Vehicle



FIGURE 10. Post-Test Left View of Test Vehicle



FIGURE 11. Pre-Test Left Rear $\frac{3}{4}$ View of Test Vehicle

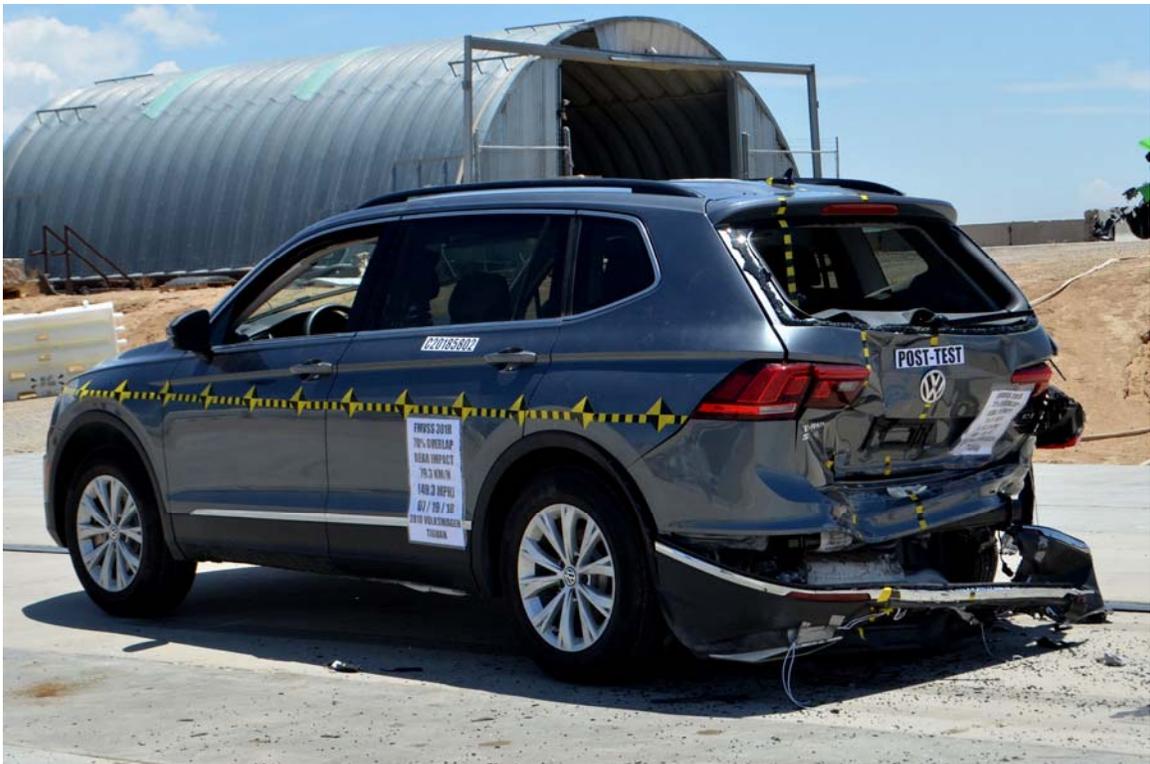


FIGURE 12. Post-Test Left Rear $\frac{3}{4}$ View of Test Vehicle



FIGURE 13. Pre-Test Rear View of Test Vehicle

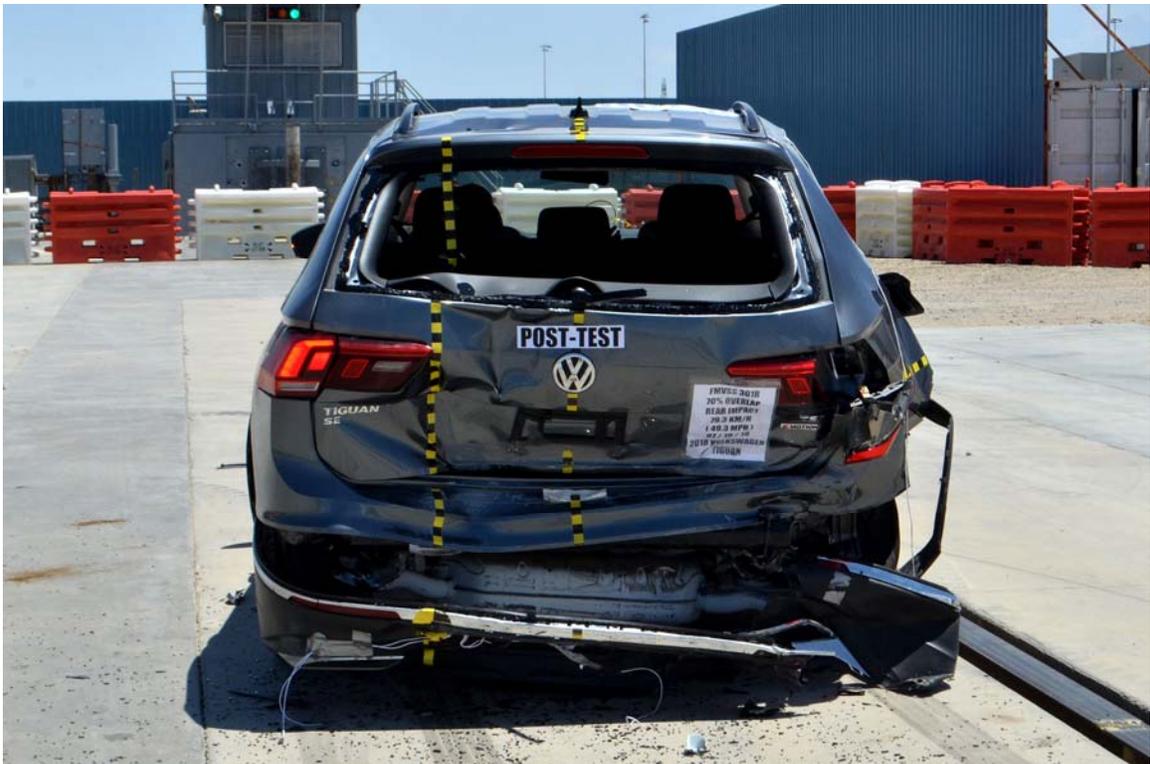


FIGURE 14. Post-Test Rear View of Test Vehicle



FIGURE 15. Pre-Test Right Rear $\frac{3}{4}$ View of Test Vehicle

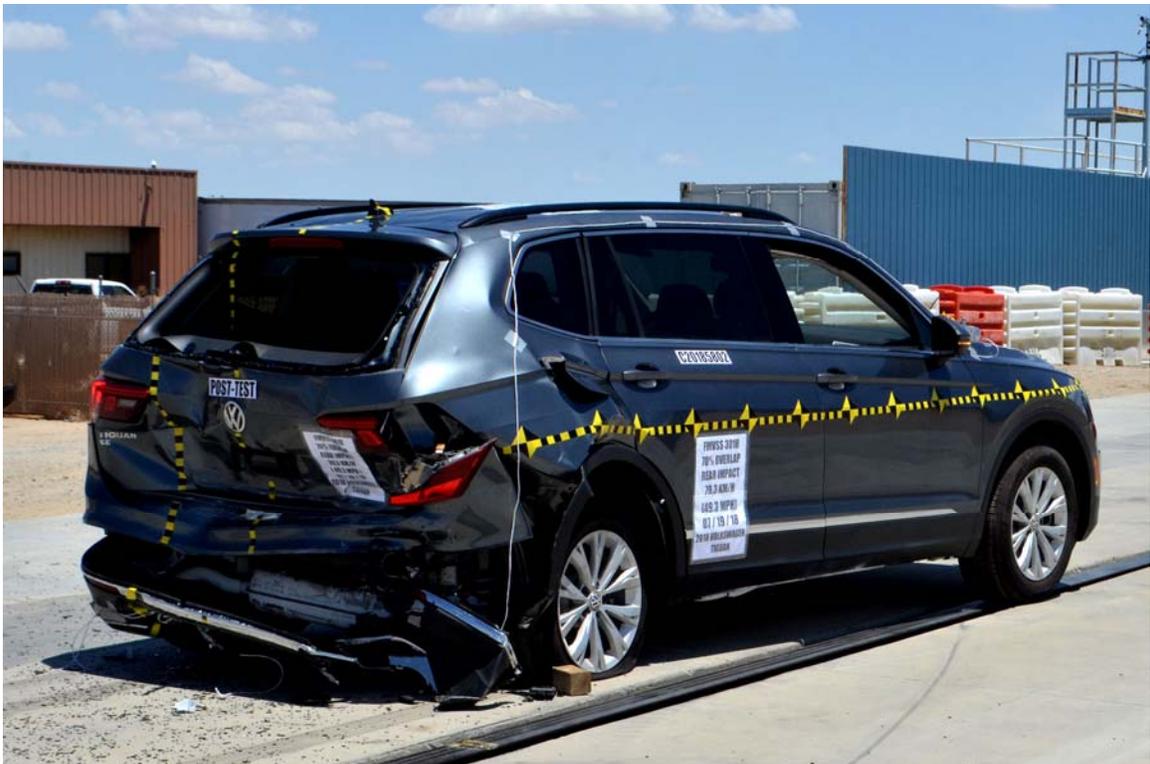


FIGURE 16. Post-Test Right Rear $\frac{3}{4}$ View of Test Vehicle



FIGURE 17. Pre-Test Right View of Test Vehicle



FIGURE 18. Post-Test Right View of Test Vehicle



FIGURE 19. Pre-Test Right Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 20. Post-Test Right Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 21. Pre-Test Close-Up View of Impact Point Target

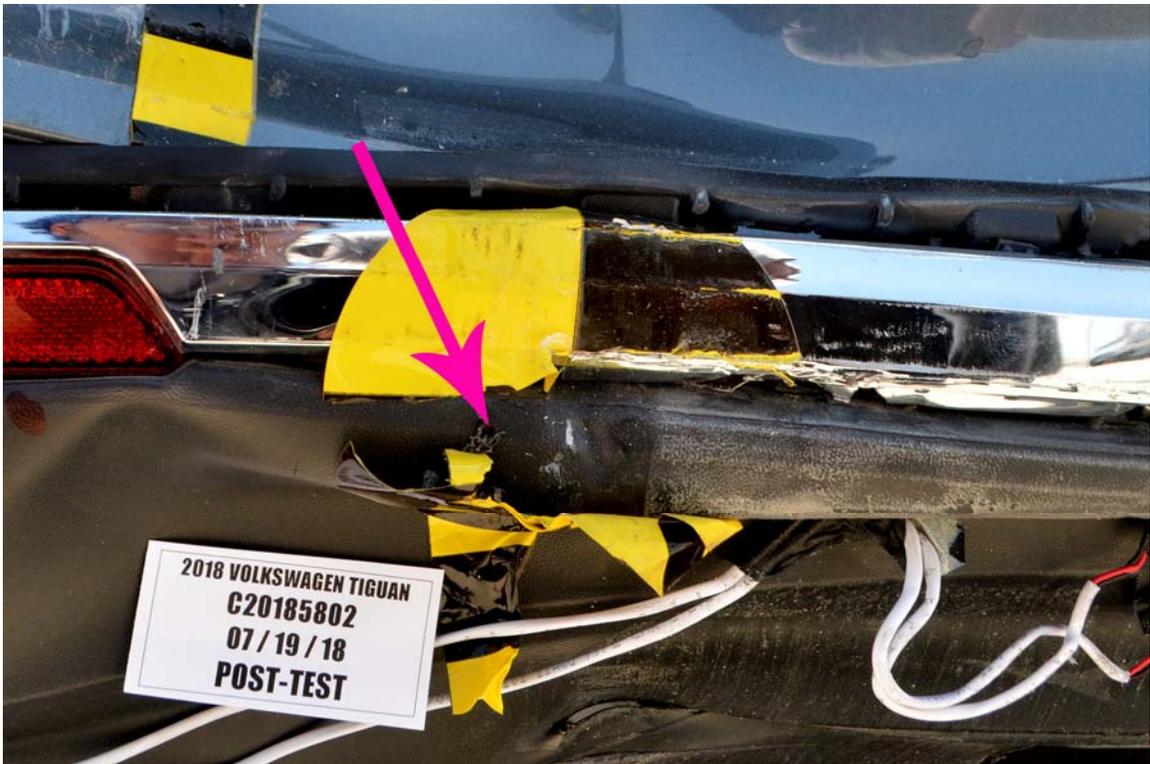


FIGURE 22. Post-Test Close-Up View of Impact Point Target



FIGURE 23. Pre-Test View of Fuel Filler Cap



FIGURE 24. Post-Test View of Fuel Filler Cap

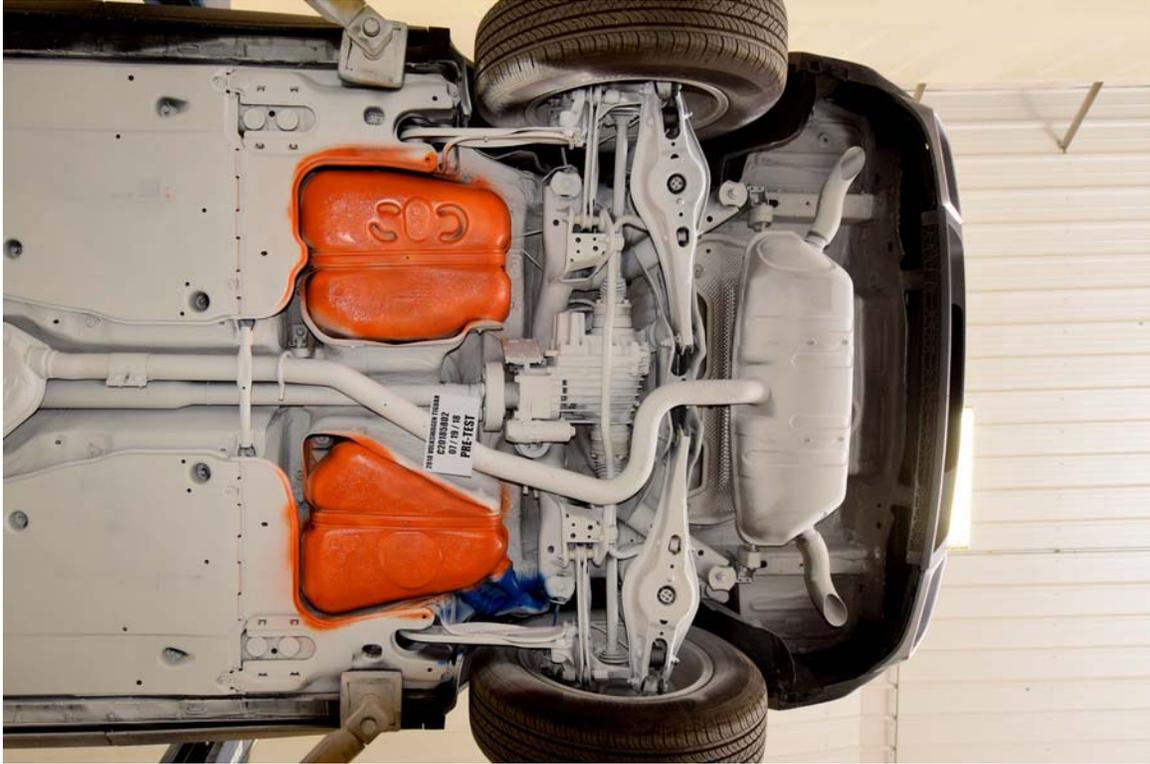


FIGURE 25. Pre-Test Rear Underbody View of Test Vehicle

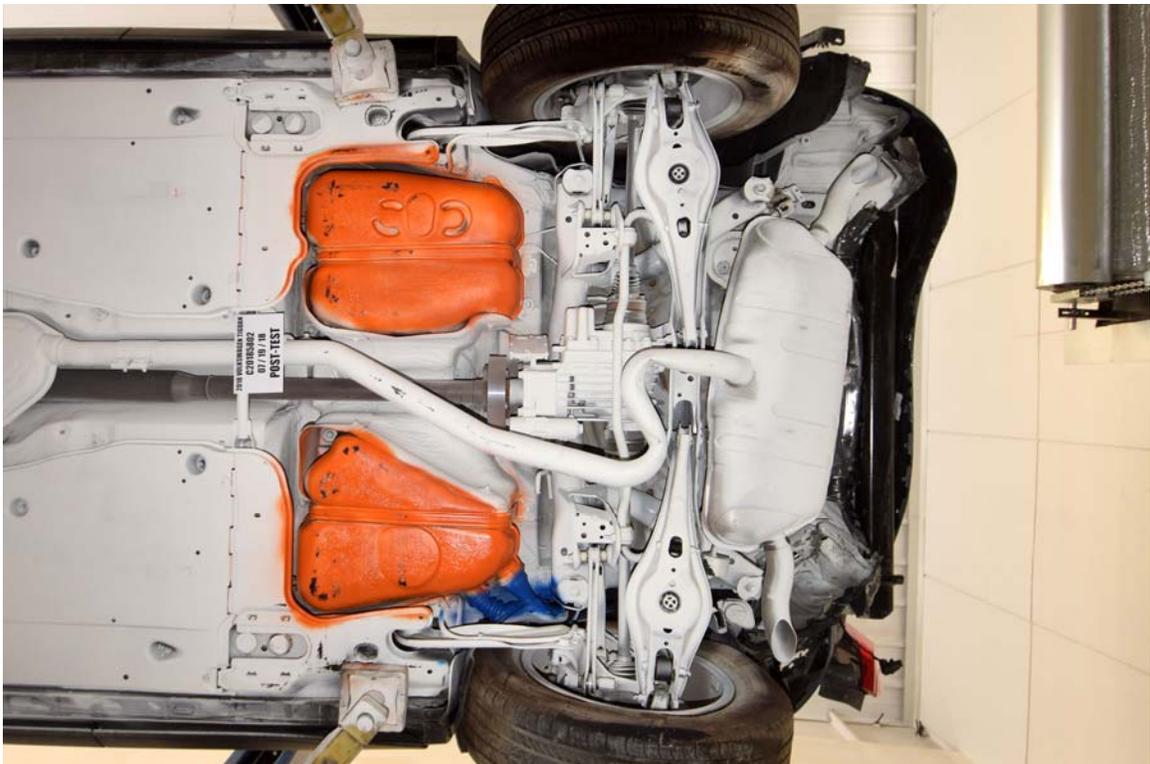


FIGURE 26. Post-Test Rear Underbody View of Test Vehicle



FIGURE 27. Pre-Test Underbody View of Fuel Tank

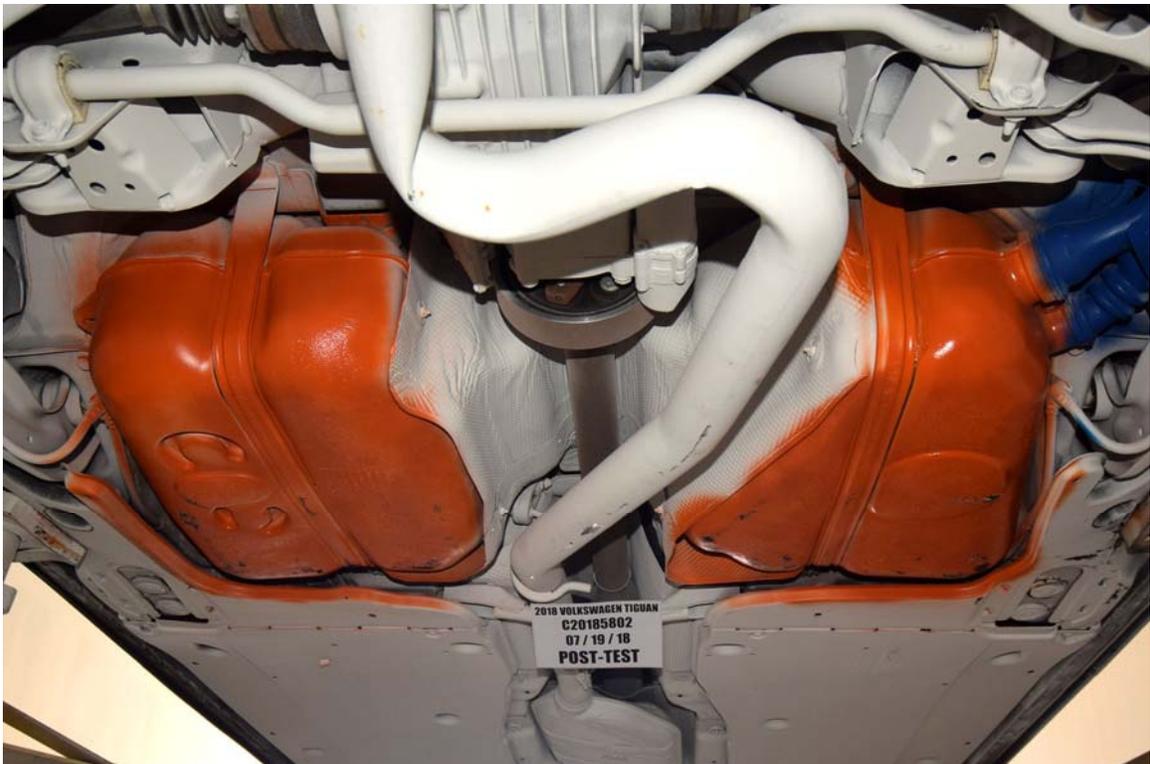


FIGURE 28. Post-Test Underbody View of Fuel Tank



FIGURE 29. Pre-Test Underbody View of Fuel Lines

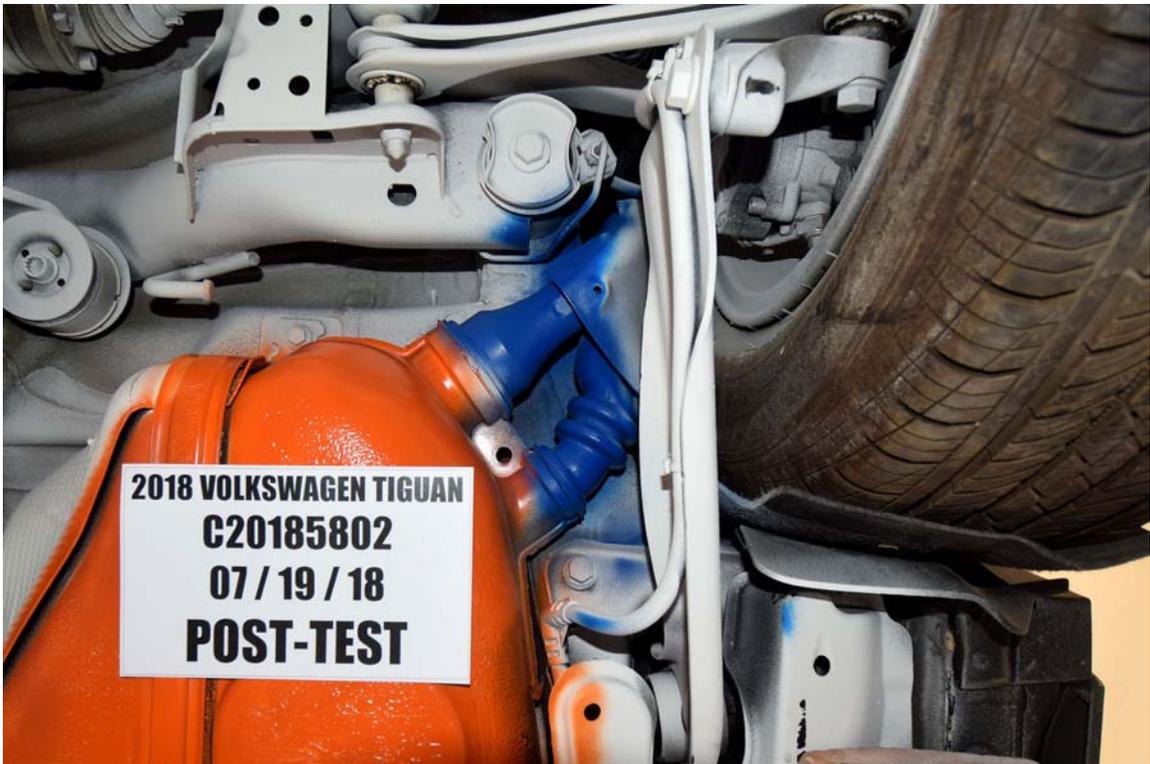


FIGURE 30. Post-Test Underbody View of Fuel Lines

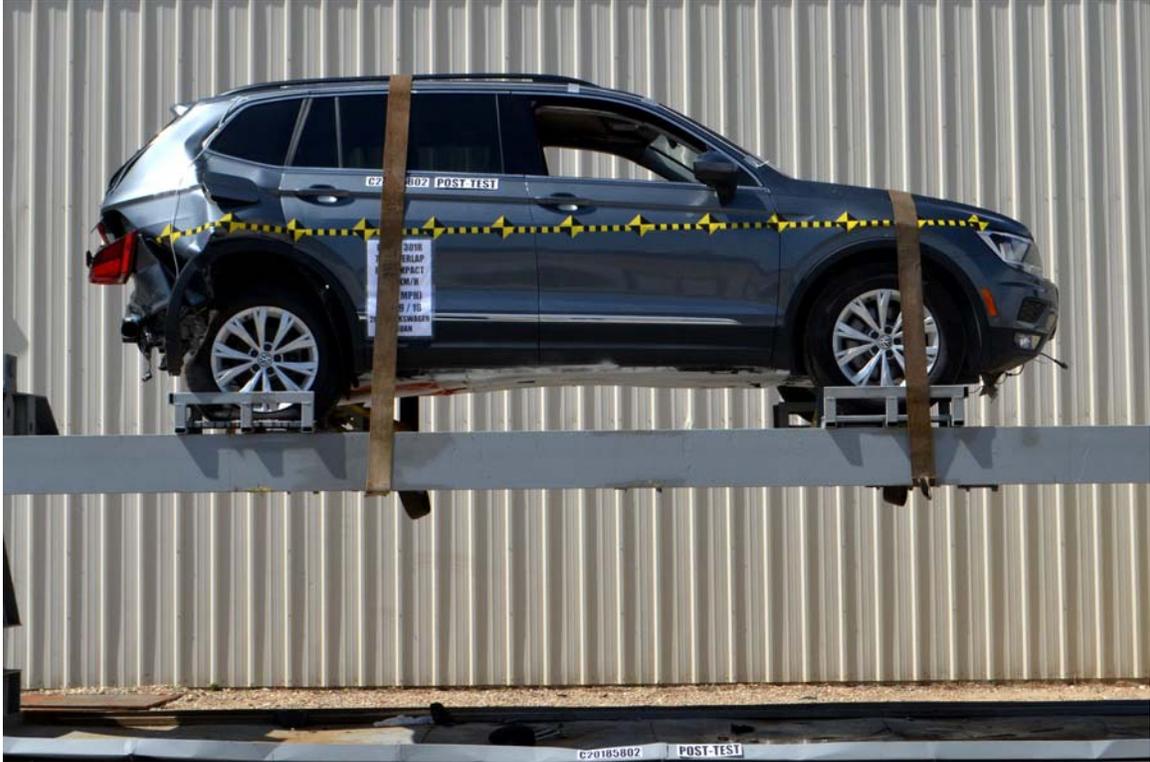


FIGURE 31. Test Vehicle at 0° on FMVSS 301 Static Rollover Device



FIGURE 32. Test Vehicle at 90° on FMVSS 301 Static Rollover Device



FIGURE 33. Test Vehicle at 180° on FMVSS 301 Static Rollover Device

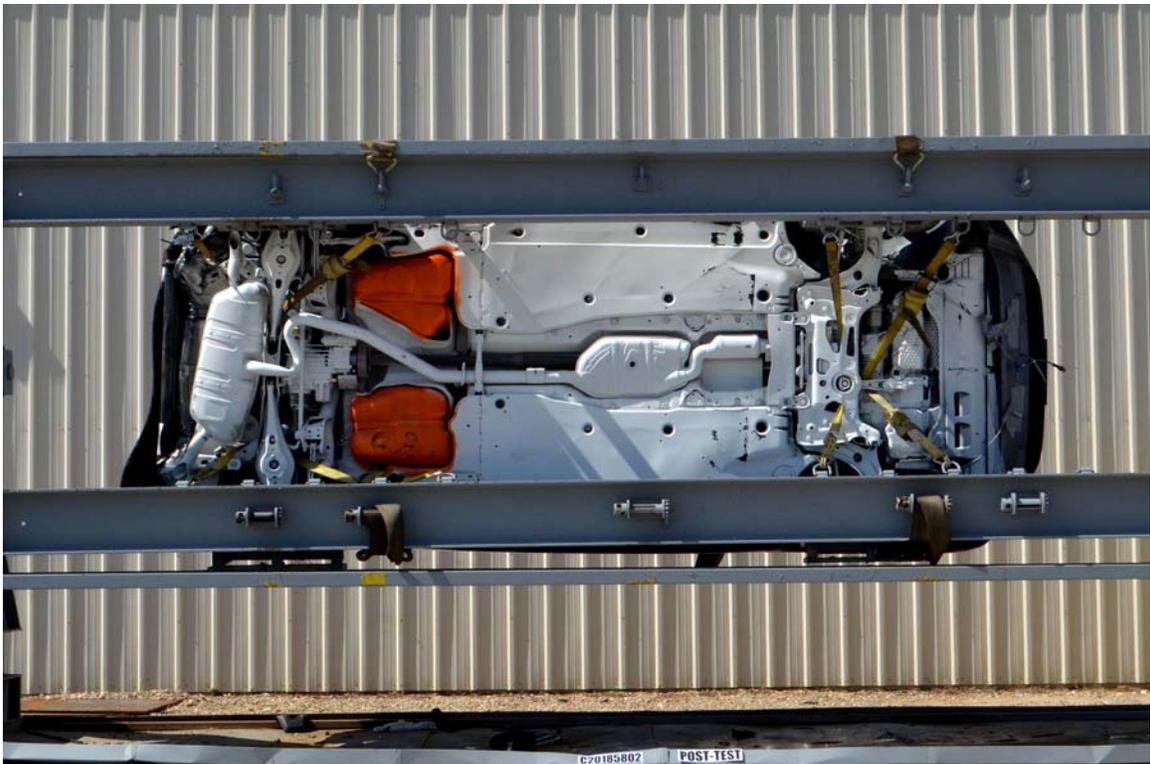


FIGURE 34. Test Vehicle at 270° on FMVSS 301 Static Rollover Device

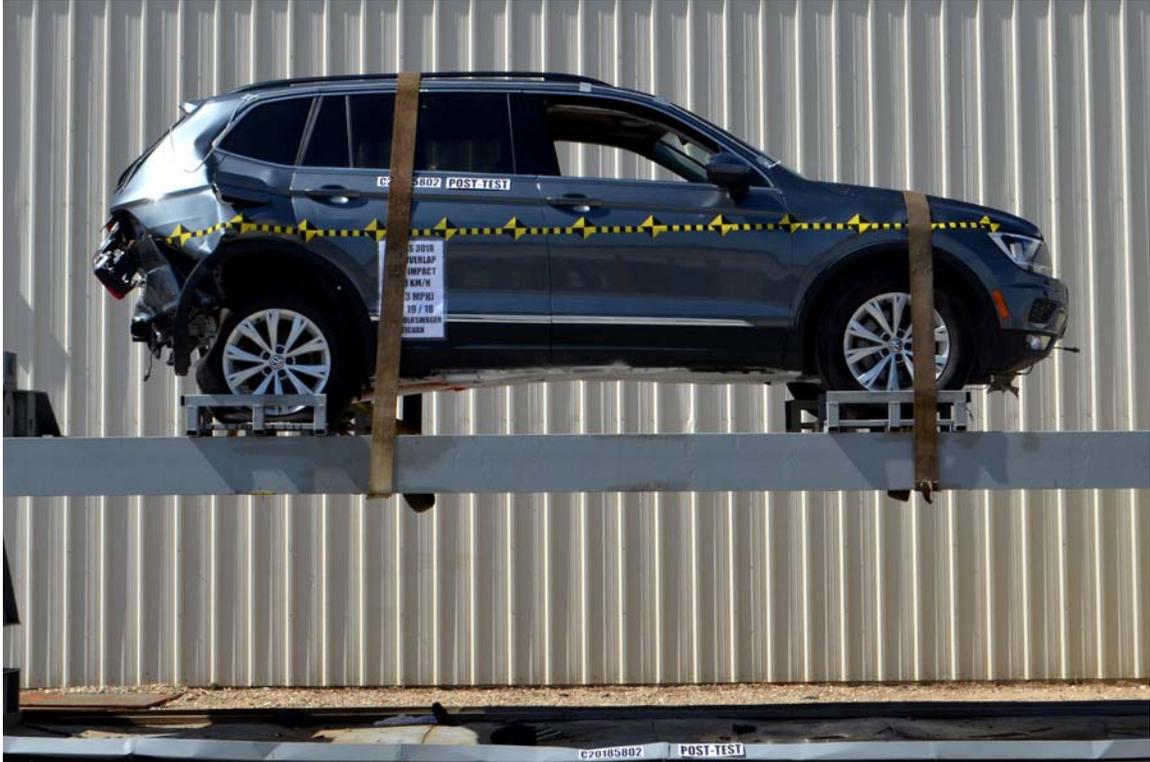


FIGURE 35. Test Vehicle at 360° on FMVSS 301 Static Rollover Device



FIGURE 36. Impact Event